

REPORT

GENERAL INFORMATION

Report Name

Skoda

Read out date

2025-05-05 15:42:53

Date of editing

2025-05-07 11:02:23

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SEDAN
Make	Skoda
Model	Tour
Engine capacity [ccm]	1595
Power [kW]	75
VIN	TMBDX21U478857234
Fuel Type	Gas
Year of production	2006


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

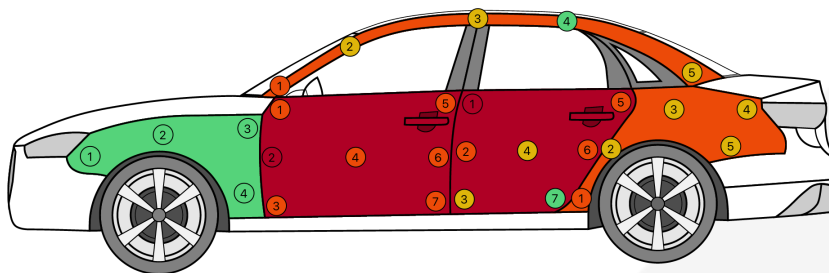


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe	127	156	144	141	154	156	127	-	-	-
left front door	Fe+Zn	398	811	496	453	811	492	450	421	448	398
left rear door	Fe	125	879	374	879	374	281	296	313	350	125
left pillar	Fe+Zn	154	357	217	357	217	190	154	166	-	-
left rear fender/ bumper	Fe+Zn	167	320	237	320	294	199	207	167	-	-

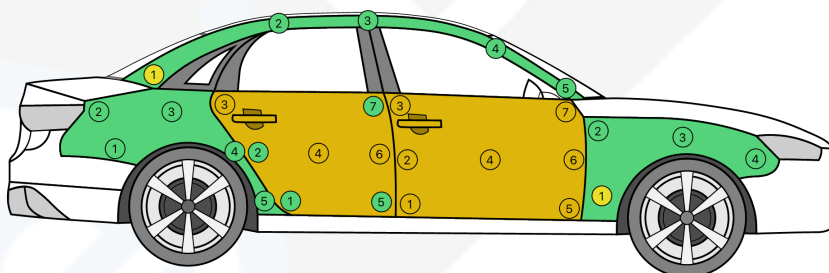

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Fe	51	97	73	51	73	71	97	-	-	-
right front door	Fe	238	267	249	238	267	242	241	242	250	265
right rear door	Fe+Zn	103	191	157	147	151	177	184	143	191	103
right pillar	Fe+Zn	68	124	101	68	106	103	102	124	-	-
right rear fender/ bumper	Fe+Zn	116	128	122	116	118	128	124	124	-	-

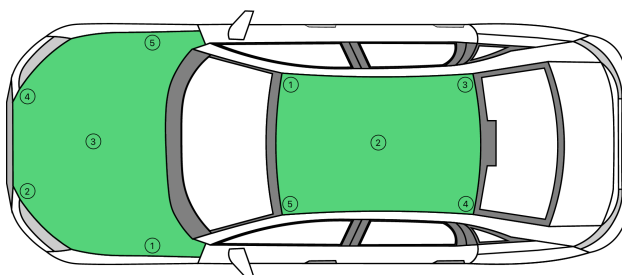

TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Fe	76	150	115	119	126	104	150	76	-	-
roof	Fe+Zn	90	129	105	90	103	129	103	98	-	-

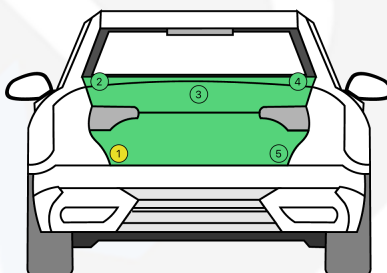


BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe+Zn	70	121	92	70	92	121	98	81	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

EXTERNAL MEASUREMENTS

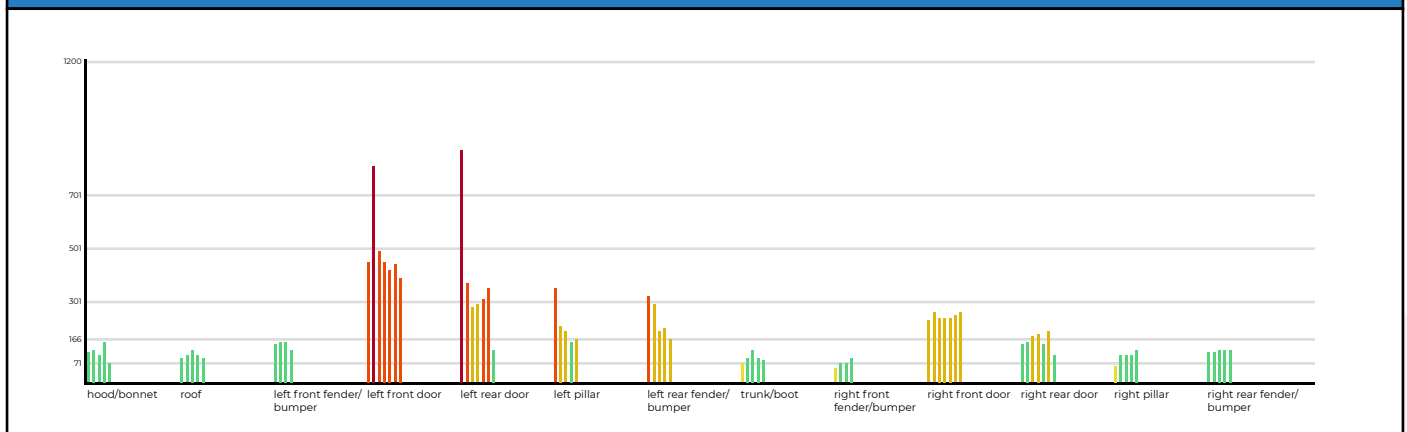

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 141	2. 154	3. 156	4. 127	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 97	3. 71	2. 73	1. 51	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	44	83	83	76										
left front door	1. 453	2. 811	3. 492	4. 450	5. 421	6. 448	7. 398	-	-	-	-	-	-	-
right front door	7. 265	6. 250	5. 242	4. 241	3. 242	2. 267	1. 238	-	-	-	-	-	-	-
DIFFERENCE	188	561	250	209	179	181	160							
left rear door	1. 879	2. 374	3. 281	4. 296	5. 313	6. 350	7. 125	-	-	-	-	-	-	-
right rear door	7. 103	6. 191	5. 143	4. 184	3. 177	2. 151	1. 147	-	-	-	-	-	-	-
DIFFERENCE	776	183	138	112	136	199	22							
left pillar	1. 357	2. 217	3. 190	4. 154	5. 166	-	-	-	-	-	-	-	-	-
right pillar	5. 124	4. 102	3. 103	2. 106	1. 68	-	-	-	-	-	-	-	-	-
DIFFERENCE	233	115	87	48	98									
left rear fender/ bumper	1. 320	2. 294	3. 199	4. 207	5. 167	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 124	4. 124	3. 128	2. 118	1. 116	-	-	-	-	-	-	-	-	-
DIFFERENCE	196	170	71	89	51									

PHOTOS

