

REPORT

GENERAL INFORMATION

Report Name

Bmw x5

Read out date

2025-04-14 10:30:08

Date of editing

2025-04-14 11:19:58

Serial number

10373 PROFESSIONAL

Unit of measure

µm


VEHICLE DATA

Type	SUV
Make	Bmw
Model	X5
Engine capacity [ccm]	2979
Power [kW]	225
VIN	5UXZV4C58BL743514
Fuel Type	Gas
Year of production	2011


MEASUREMENTS

"-" means measurement skip, "∞" means measurement out of range


PAS: general interpretation, body

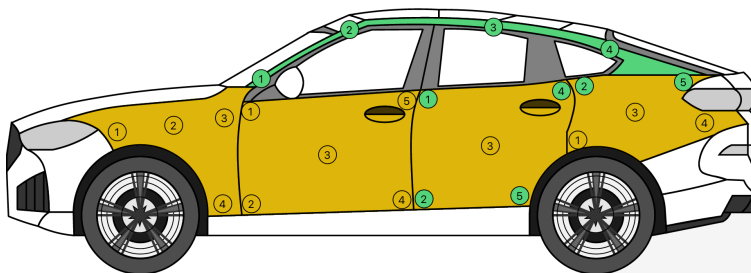


LEFT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
left front fender/ bumper	Fe+Zn	194	263	226	214	194	234	263	-	-	-
left front door	Fe+Zn	171	218	191	218	200	186	171	180	-	-
left rear door	Fe+Zn	105	204	137	123	128	204	124	105	-	-
left pillar	Fe+Zn	115	156	133	115	121	156	139	-	-	-
left rear fender/ bumper	Fe+Zn	138	221	183	198	138	217	221	141	-	-

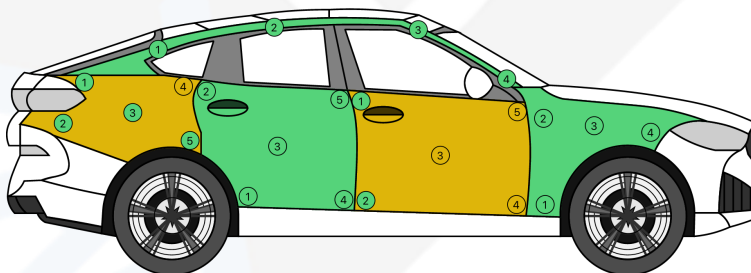

RIGHT SIDE											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
right front fender/ bumper	Al	105	126	111	126	105	105	107	-	-	-
right front door	Fe+Zn	144	195	169	153	144	173	179	195	-	-
right rear door	Fe+Zn	88	124	105	88	100	105	124	106	-	-
right pillar	Fe+Zn	125	143	133	143	128	136	125	-	-	-
right rear fender/ bumper	Fe	105	193	138	114	145	105	193	135	-	-

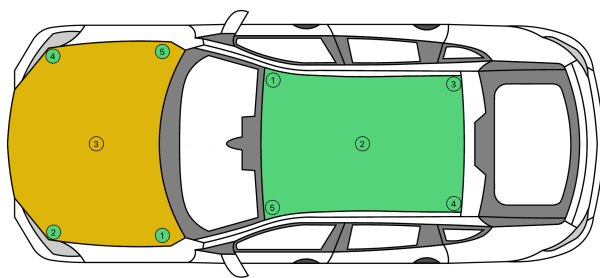


TOP											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
hood/bonnet	Al	105	190	141	110	105	190	157	145	-	-
roof	Fe+Zn	123	153	137	131	136	153	144	123	-	-

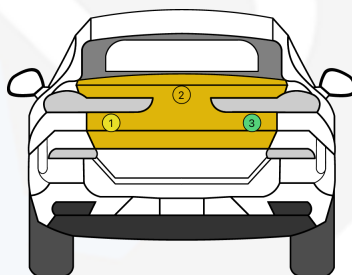

BACK											
	Coating	Minimum	Maximum	Medium	1.	2.	3.	4.	5.	6.	7.
trunk/boot	Fe	63	224	121	63	224	75	-	-	-	-

Legend

- Disabled
- Paint layer is too thin
- Paint layer is original
- Second layer of paint
- A thin layer of putty
- A thick layer of putty

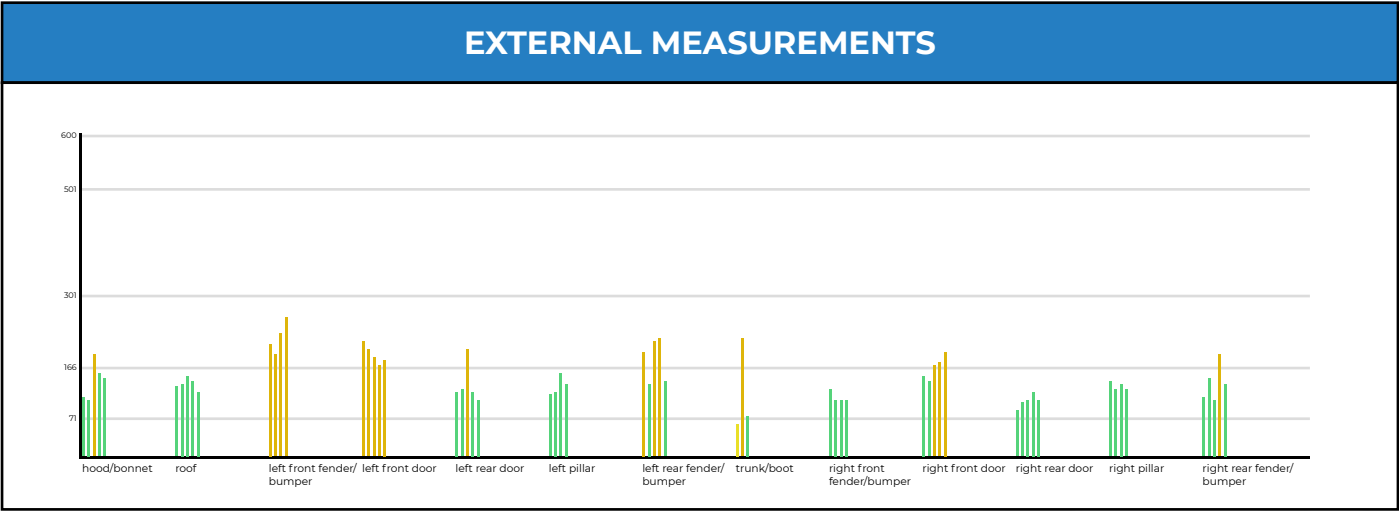

SYMMETRIC MEASUREMENTS

EXTERNAL MEASUREMENTS														
left front fender/ bumper	1. 214	2. 194	3. 234	4. 263	-	-	-	-	-	-	-	-	-	-
right front fender/ bumper	4. 107	3. 105	2. 105	1. 126	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	107	89	129	137										
left front door	1. 218	2. 200	3. 186	4. 171	5. 180	-	-	-	-	-	-	-	-	-
right front door	5. 195	4. 179	3. 173	2. 144	1. 153	-	-	-	-	-	-	-	-	-
DIFFERENCE	23	21	13	27	27									
left rear door	1. 123	2. 128	3. 204	4. 124	5. 105	-	-	-	-	-	-	-	-	-
right rear door	5. 106	4. 124	3. 105	2. 100	1. 88	-	-	-	-	-	-	-	-	-
DIFFERENCE	17	4	99	24	17									
left pillar	1. 115	2. 121	3. 156	4. 139	-	-	-	-	-	-	-	-	-	-
right pillar	4. 125	3. 136	2. 128	1. 143	-	-	-	-	-	-	-	-	-	-
DIFFERENCE	10	15	28	4										
left rear fender/ bumper	1. 198	2. 138	3. 217	4. 221	5. 141	-	-	-	-	-	-	-	-	-
right rear fender/ bumper	5. 135	4. 193	3. 105	2. 145	1. 114	-	-	-	-	-	-	-	-	-
DIFFERENCE	63	55	112	76	27									